

7-11-75

F16CN

0006

02210

2874-62

2-3-2



5-22-82

1" = 400'

1982

KENAI R

120

N

39



COOPER LANDING

1"=500'

5-31-90

9-12

1990

0 4 0



U.S. SURVEY
No. 3531 ALASKA

EMBRACING
LOTS 1, 2, 2A, 3, 3A, 4, 5, 5A, and 6

SITUATED
ON THE SOUTHERLY SIDE OF THE SNUG HARBOR ROAD
AT KENAI LAKE

Geographic Position at Corner No. 1

Latitude $60^{\circ}29\frac{1}{2}'$ N. Longitude $149^{\circ}47'$ W.
(Approximate)

AREA: 15.36 ACRES

SURVEYED BY
HAROLD RADCLIFFE, CADASTRAL SURVEYOR

Survey Commenced May 2, 1957
Survey Completed May 11, 1957



Under Special Instructions
Dated May 2, 1957
Approved May 4, 1957

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Washington, D. C. August 26, 1958



This plat is strictly conformable to the approved field notes, and the survey, having been correctly executed in accordance with the requirements of law and the regulations of this Bureau, is hereby accepted.

For the Director

Earl S. Harrington
Cadastral Engineering Staff Officer

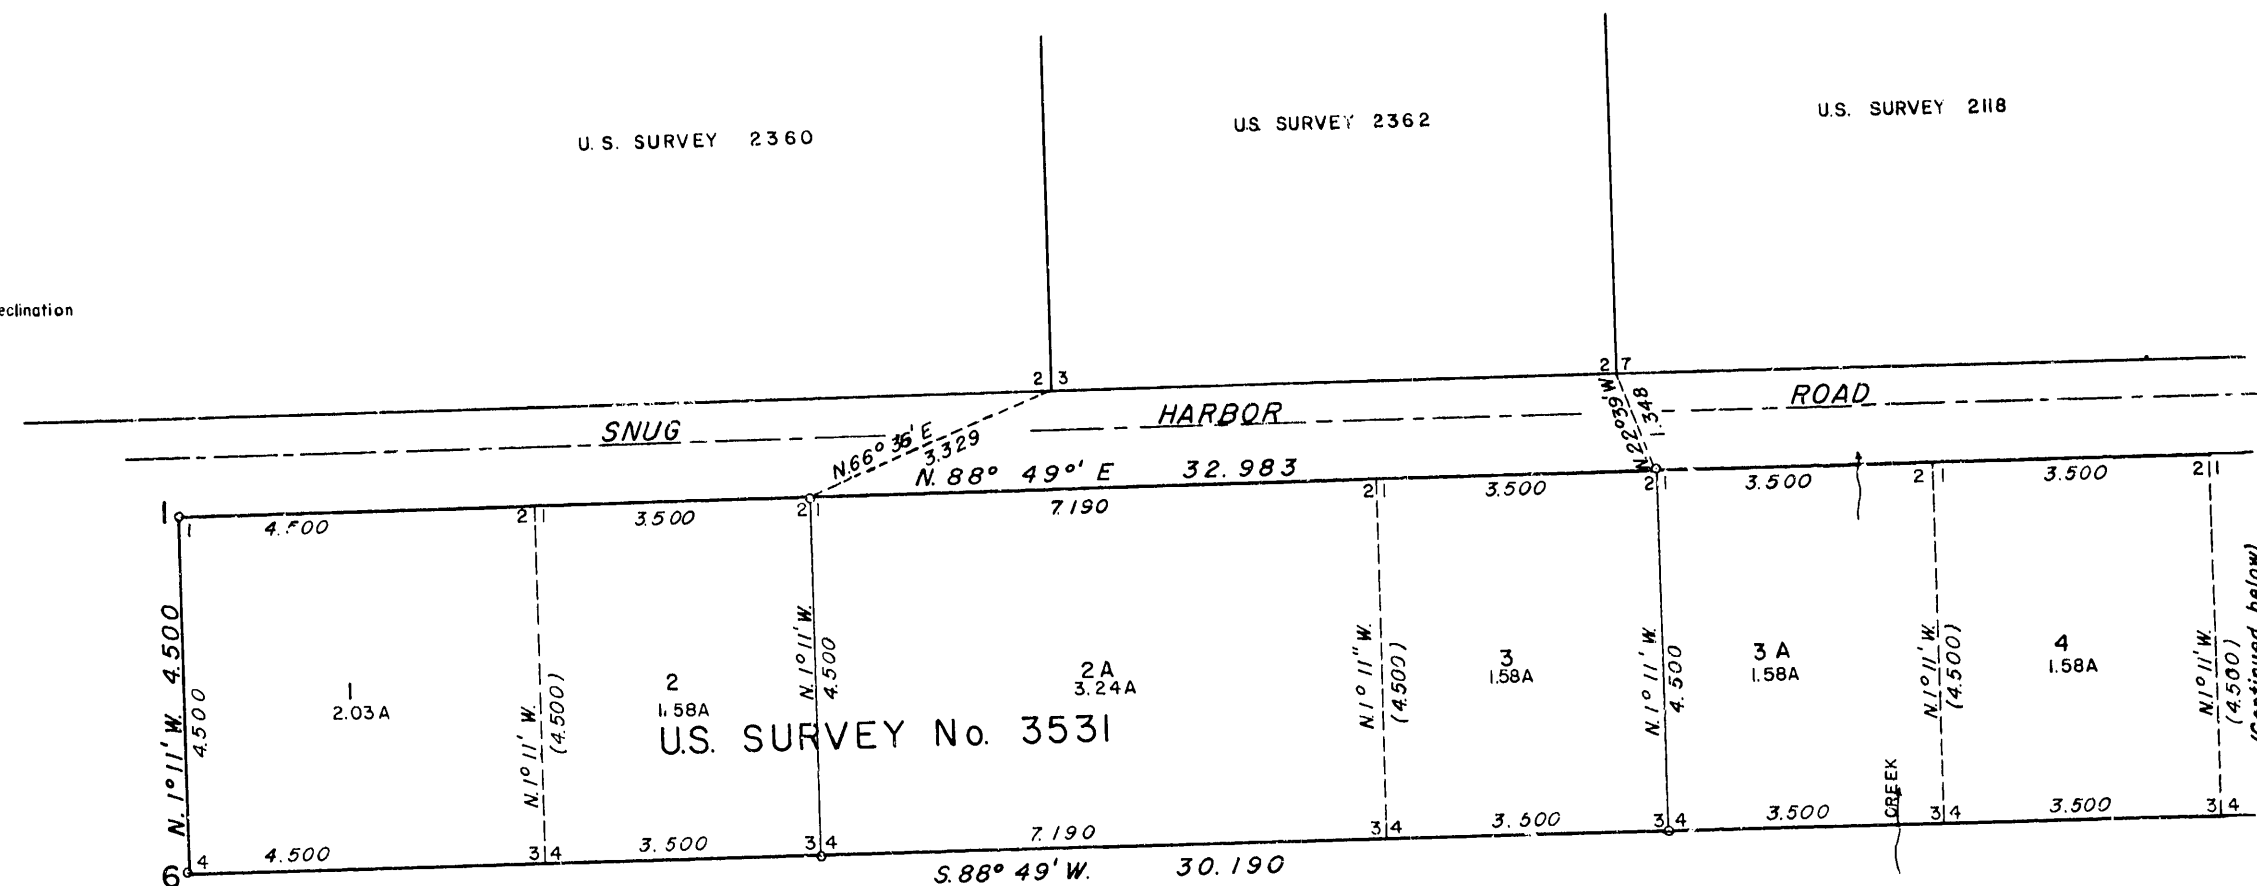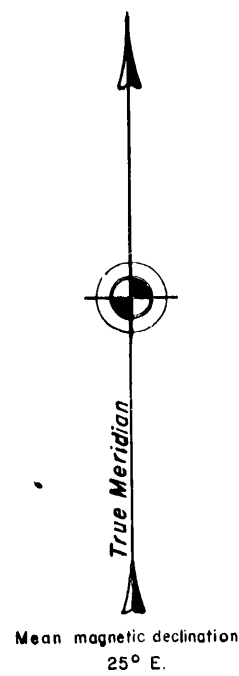

○ INDICATES AN IRON POST MONUMENT
OTHER MONUMENTS ARE WOODEN POST

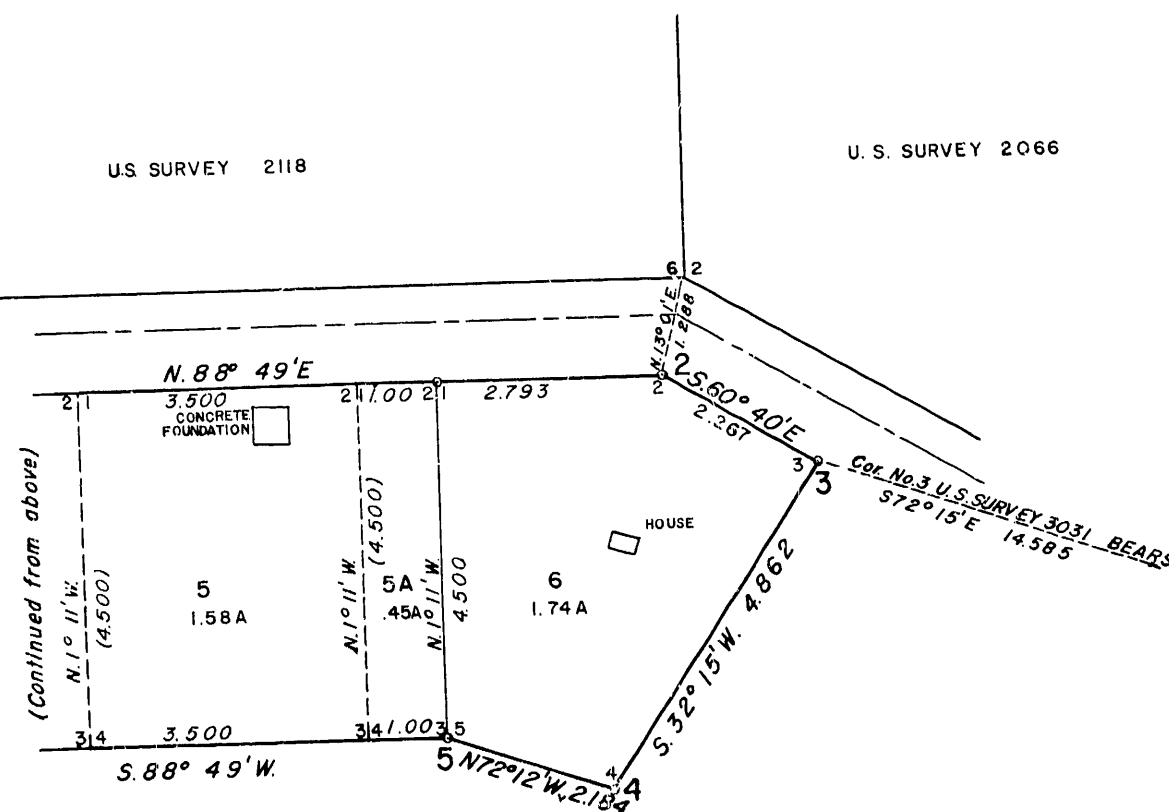

DEPENDENT RESURVEY
OF
U.S. SURVEY
No. 3531, ALASKA

THE DEPENDENT RESURVEY OF LOT 2A,
THE SUBDIVISION OF LOT 2A,
THE ADDITION OF LOT 2D,
AND REMONUMENTATION OF CERTAIN LOT CORNERS
SITUATED
ON THE SOUTHERLY SIDE
OF THE SNUG HARBOR ROAD
AT KENI LAKE

APPROXIMATE GEODETIC POSITION
OF CORNER NO. 1, LOT 1
LATITUDE $60^{\circ} 29.5'$ NORTH, LONGITUDE $149^{\circ} 47'$ WEST

AREA RESURVEYED: 3.24 ACRES
AREA SURVEYED: 0.54 ACRES

SURVEYED BY:
EDWARD T. PRENDERGAST, CADASTRAL SURVEYOR
AUGUST 22 THROUGH AUGUST 25, 1969

Under Special Instructions
Dated January 20, 1969
Approved January 20, 1969



UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Washington, D. C. October 20, 1970

This plat is strictly conformable to the approved field notes, and the survey, having been correctly executed in accordance with the requirements of law and the regulations of this Bureau, is hereby accepted.


For the Director

Clark F. Lumm

Chief, Division of Cadastral Survey

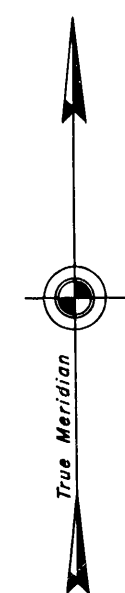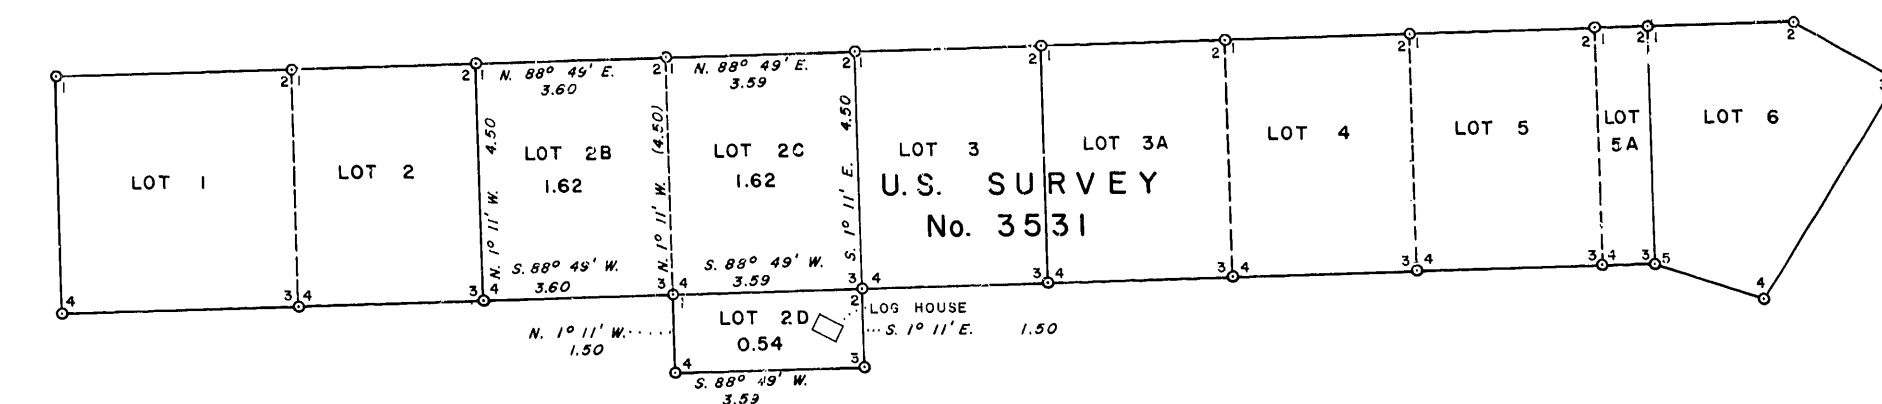

Magnetic
Declination
 25° E.



○ BRASS CAPPED IRON POST

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

BUREAU OF LAND MANAGEMENT

RECEIVED
SEP 17 1958

FIELD NOTES

SURVEY OFFICE
Anchorage, Alaska

OF

U. S. SURVEY NO. 3531

EMBRACING LOTS 1, 2, 2A, 3, 3A, 4, 5, 5A, AND 6.

SITUATED

ON THE SOUTHERLY SIDE OF THE SNUG HARBOR ROAD AT KENAI LAKE

GEOGRAPHIC POSITION AT COR. NO. 1

LATITUDE $60^{\circ} 29\frac{1}{2}'$ N. LONGITUDE $149^{\circ} 47'$ W.
(APPROXIMATE)

Of the Meridian,

In the ~~State of~~ TERRITORY OF ALASKA

EXECUTED BY

HAROLD RADCLIFFE, CADASTRAL SURVEYOR

Under special instructions dated MAY 2, 1957, which provided
U.S. Survey
for the surveys included under ~~Group~~ No. 3531, approved MAY 4, 1957
supplemental
and assignment instructions dated APRIL 29, 1957

Survey commenced MAY 2, 1957

Survey completed MAY 11, 1957

1.

U. S. SURVEY NO. 3531

Chains

Survey commenced May 2, 1957. In the execution of this survey, I use the same transit, tape and method as used in U. S. Survey No. 3392.

Due to adverse weather conditions during the survey, I was unable to obtain an azimuth by direct observations upon the sun, therefore I use the same azimuth which was established in 1930 in U. S. Survey No. 2066 by Chas. P. Seelye.

All lines are deflected from the true meridian, and carried throughout the survey, by the double center method.

The magnetic declination is 25° E.

Begin at the point for Cor. No. 1, U. S. Survey No. 3531, and Cor. No. 1, Lot 1, offset 50 ft. from the center line of the Snug Harbor Road.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground with brass cap mkd.

S3531
C1
L1

1957

from which

A spruce, 3 ins. diam., bears S. 38° E., 0.125 chs. dist., mkd. BT.

A spruce, 3 ins. diam., bears S. 67° E., 0.04 chs. dist., mkd. BT.

N. $88^{\circ} 49'$ E.

On line 1-2, identical with line 1-2 Lots 1, 2, 2A, 3, 3A, 4, 5, 5A, and 6, 50 ft. from center line of road.

Over gently rolling land through spruce and aspen timber, alder and willow undergrowth.

4.50 Point for Cor. No. 2, Lot 1, identical with Cor. No. 1, Lot 2.

Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground mkd. L1 on W., L2 on E., and S3531 on S. side.

8.00 Point for Cor. No. 2, Lot 2, identical with Cor. No. 1, Lot 2A.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground with brass cap mkd.

L2 L2A
C2 C1

S3531

1957

from which

A spruce, 4 ins. diam., bears S. 18° W., 0.215 chs. dist., mkd. S 3531 L2 C2 BT.

A spruce, 5 ins. diam., bears S. 63° E., 0.495 chs. dist., mkd. S 3531 L2A C1 BT.

U. S. SURVEY NO. 3531

Chains

- Cor. No. 2, U. S. Survey No. 2360, identical with Cor. No. 3, U. S. Survey No. 2362, monumented with an iron post, 2 ins. diam., projecting 6 ins., firmly set, mkd., and witnessed as described in the official record, bears N. $66^{\circ} 36'$ E., 3.329 chs. dist.
- 15.19 Point for Cor. No. 2, Lot 2A, identical with Cor. No. 1, Lot 3.
- Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground, mkd. L2A on W., L3 on E., and S 3531 on S. side.
- 18.69 Point for Cor. No. 2, Lot 3, identical with Cor. No. 1, Lot 3A.
- Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground, with brass cap mkd.
- | | |
|----|-----|
| L3 | L3A |
| C2 | C1 |
- S 3531
1957
- from which
- A spruce, 8 ins. diam., bears S. 59° W., 0.145 chs. dist., mkd. S 3531 L3 C2 BT.
- A cottonwood, 6 ins. diam., bears S. 34° E., 0.185 chs. dist., mkd. S 3531 L3A C1 BT.
- Cor. No. 2, U. S. Survey No. 2362, identical with Cor. No. 7, U. S. Survey No. 2118, monumented as described in the official record, bears N. $22^{\circ} 39'$ W., 1.348 chs. dist.
- 21.27 Creek 4 lks. wide, 3 ins. deep; course North.
- 22.19 Point for Cor. No. 2, Lot 3A, identical with Cor. No. 1, Lot 4.
- Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground mkd. L3A on W., L4 on E., and S 3531 on S. side.
- 25.69 Point for Cor. No. 2, Lot 4, identical with Cor. No. 1, Lot 5.
- Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground mkd. L4 on W., L5 on E., and S 3531 on S. side.
- 29.19 Point for Cor. No. 2, Lot 5, identical with Cor. No. 1, Lot 5A.
- Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground, mkd. L5 on W., L5A on E., and S 3531 on S. side.
- from which
- NE. corner of a concrete foundation, 30 X 30 ft., bears S. 70° W., 0.87 chs. dist., side extends West.
- 30.19 Point for Cor. No. 2, Lot 5A, identical with Cor. No. 1, Lot 6.
- Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground with brass cap mkd.
- | | |
|-----|----|
| L5A | L6 |
| C2 | C1 |
- S 3531
1957
- from which

U. S. SURVEY NO. 3531

Chains

A spruce, 4 ins. diam., bears S. 57° W., 0.445 chs. dist., mkd.
S 3531 C2 I5A BT.

A spruce, 4 ins. diam., bears S. 75° E., 0.37 chs. dist., mkd.
S 3531 I6 C1 BT.

32.983 Point for Cor. No. 2, U. S. Survey No. 3531, identical with Cor. No. 2, Lot 6.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground with brass cap mkd.

S 3531

C2

I6

1957

from which

The most easterly corner of a building, 15 X 18 ft., bears
S. $8^{\circ} 42'$ W., 2.085 chs. dist., longside extends N. 75° W.

Cor. No. 2, U. S. Survey No. 2066, identical with Cor. No. 6,
U. S. Survey No. 2118, monumented as described in the official
record, bears N. $13^{\circ} 01'$ E., 1.288 chs.

S. $60^{\circ} 40'$ E.

On line 2-3, identical with line 2-3, Lot 6.

2.267 Point for Cor. No. 3, U. S. Survey No. 3531, identical with Cor. No. 3, Lot 6.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground with brass cap mkd.

S 3531

C3

I6

1957

from which

An aspen, 8 ins. diam., bears S. 83° W., 0.515 chs. dist., mkd.
S 3531 C3 I6 BT.

An aspen, 8 ins. diam., bears S. 55° W., 0.31 chs. dist., mkd.
S. 3531 C3 I6 BT.

Cor. No. 3, U. S. Survey No. 3031, monumented as described in the
official record bears S. $72^{\circ} 15'$ E., 14.585 chs. dist.

S. $32^{\circ} 15'$ W.

On line 3-4, U. S. Survey No. 3531, identical with line 3-4, Lot 6.

Ascend gentle N. slope, through small spruce and aspen timber, alder
and willow undergrowth.

4.862 Point for Co. No. 4, U. S. Survey No. 3531, identical with Cor. No. 4, Lot 6.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., flush with the ground with brass cap mkd.

U. S. SURVEY NO. 3531

Chains

S 3531.

Ch

L6

1957

from which

An aspen, 6 ins. diam., bears N. 30° W., 0.035 chs. dist., mkd.
S. 3531 Ch L6 BT.

An aspen, 8 ins. diam., bears N. 30° E., 0.53 chs. dist., mkd.
S 3531 Ch L6 BT.

N. 72° 12' W.

On line 4-5, identical with line 4-5, Lot 6.

2.184 Point for Cor. No. 5, U. S. Survey No. 3531, identical with Cor. No.
5, Lot 6 and Cor. No. 3, Lot 5A.

Set an iron post, 28 ins. long, 2½ ins. diam., flush with the ground
with brass cap mkd.

S 3531 C5

L5A

C3

L6

C5

1957

from which

An aspen, 8 ins. diam., bears N. 13° W., 0.455 chs. dist., mkd.
S 3531 C5 L5A C3 BT.

A spruce, 6 ins., diam., bears S. 78° E., 0.175 chs. dist.,
mkd. S 3531 C5 L6 BT.

S. 88° 49' W.

On line 5-6, identical with line 3-4 Lots 5A, 5, 4, 3A, 3, 2A, 2, and 1.

Over gently rolling land through small spruce and aspen timber, willow
and alder undergrowth.

1.00 Point for Cor. No. 4, Lot 5A, identical with Cor. No. 3, Lot 5.

Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground mkd.
L5 on W., L5A on E., and S 3531 on N. side.

4.50 Point for Cor. No. 4, Lot 5, identical with Cor. No. 3, Lot 4.

Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground mkd.
L4 on W., L5 on E., and S 3531 on N. side.

8.00 Point for Cor. No. 4, Lot 4, identical with Cor. No. 3, Lot 3A.

Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground mkd.
L3A on W., L4 on E., and S 3531 on N. side.

8.58 Creek 4 lks. wide, 3 ins. deep, course North.

11.50 Point for Cor. No. 4, Lot 3A, identical with Cor. No. 3, Lot 3.

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground

U. S. SURVEY NO. 3531

Chains

with brass cap mkd.

S 3531
L3 L3A
C3 Ch

1957

from which

An aspen, 4 ins. diam., bears N. 48° W., 0.07 chs. dist., mkd.
S 3531 L3 C3 BT.

A spruce, 4 ins. diam., bears N. 47° E., 0.105 chs. dist., mkd.
S 3531 L3A Ch BT.

15.00 Point for Cor. No. 4, Lot 3, identical with Cor. No. 3, Lot 2A.

Set a woodpost, 2 X 3 ins., 36 ins. long, 18 ins. in the ground, mkd.
L2A on W., L3 on E., and S 3531 on N. side.

22.19 Point for Cor. No. 4, Lot 2A, identical with Cor. No. 3, Lot 2.

Set an iron post, 28 ins. long, 2½ ins. diam., flush with the ground
with brass cap mkd.

S 3531
L2 L2A
C3 Ch

1957

from which

A spruce, 8 ins. diam., bears N. 24° E., 0.315 chs. dist., mkd.
S 3531 L2A Ch BT.

A spruce, 8 ins. diam., bears N. 13° W., 0.245 chs. dist., mkd.
S 3531 L2 C3 BT.

25.69 Point for Cor. No. 4, Lot 2, identical with Cor. No. 3, Lot 1.

Set a wood post, 2 X 3 ins., 36 ins. long, 18 ins. in the ground,
mkd. L1 on W., L2 on E., and S 3531 on N. side.

30.19 Point for Cor. No. 6, U. S. Survey No. 3531, identical with Cor. No.
4, Lot 1.

Set an iron post, 28 ins. long, 2½ ins. diam., flush with the ground
with brass cap mkd.

S 3531
C6
L1 Ch

1957

from which

A spruce, 1½ ins. diam., bears N. 30° E., 0.36 chs. dist., mkd.
S 3531 C6 L1 Ch BT.

A spruce, 6 ins. diam., bears N. 83° E., 0.20 chs. dist., mkd.
S 3531 C6 L1 Ch BT.

N. 1° 11' W.

On line 6-1, identical with line 4-1, Lot 1.

U. S. SURVEY NO. 3531

Chains

Descend N. slope, through scrub spruce timber.

4.50

Cor. No. 1, place of beginning, containing 15.36 acres.

GENERAL DESCRIPTION

This tract is located on the South side of the Snug Harbor Road and West of Schakleford Creek at Kenai Lake, and is subdivided into 9 lots. The land is on a gentle North and covered with small spruce and aspen timber, willow and alder undergrowth. The soil is composed of moss, silt and gravel.

CERTIFICATE OF CADASTRAL ENGINEER

I, HAROLD RADCLIFFE, HEREBY CERTIFY upon honor that, in pursuance of special instructions bearing date of the 2nd day of MAY, 1957, I have surveyed U. S. SURVEY NO. 3531, EMBRACING LOTS 1, 2, 2A, 3, 3A, 4, 5, 5A, AND 6. SITUATED ON THE SOUTHERLY SIDE OF THE SNUG HARBOR ROAD AT KENAI LAKE.

of the Meridian, in the STATE TERRITORY OF ALASKA, which are represented in the foregoing field notes as having been executed by me and under my direction; and that said survey has been made in strict conformity with said instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in the specific manner described in the foregoing field notes.

June 1958
Anchorage, Alaska

Harold Radcliffe
Harold Radcliffe, Cadastral Surveyor

CERTIFICATE OF APPROVAL

BUREAU OF LAND MANAGEMENT,

Washington, D. C., AUG 26 1958, 19

The foregoing field notes of the survey of U. S. SURVEY NO. 3531, EMBRACING LOTS 1, 2, 2A, 3, 3A, 4, 5, 5A, AND 6. SITUATED ON THE SOUTHERLY SIDE OF THE SNUG HARBOR ROAD AT KENAI LAKE.

executed by HAROLD RADCLIFFE, CADASTRAL SURVEYOR

having been critically examined and found correct, are hereby approved.

Earl G. Harrington
Cadastral Engineering Staff Officer

~~CERTIFICATE OF TRANSCRIPT~~

~~I CERTIFY that the foregoing transcript of the field notes of the above described surveys in~~
~~is a true copy of the original field notes.~~

~~Cadastral Engineering Staff Officer~~

ORIGINAL

Form 9180-t.
(April 1965)
(formerly 4-679)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

282

FIELD NOTES

OF

THE DEPENDENT RESURVEY OF LOT 2A U.S. SURVEY NO. 3531

THE SUBDIVISION OF LOT 2A,

THE ADDITION OF LOT 2D

AND

REMONUMENTATION OF CERTAIN LOT CORNERS

SITUATED

ON THE SOUTHERLY SIDE OF THE SNUG HARBOR ROAD AT KENAI LAKE

APPROXIMATE GEODETIC POSITION OF CORNER NO. 1, LOT 1

LATITUDE $60^{\circ} 29.5'$ NORTH - LONGITUDE $149^{\circ} 47'$ WEST

Of the _____ Meridian,

In the State of _____ ALASKA _____.

EXECUTED BY

EDWARD T. PRENDERGAST, CADASTRAL SURVEYOR

Under special instructions dated _____ JANUARY 20 _____, 19 69, which provided for the surveys
U.S. SURVEY NO. 3531

included under ~~Contract~~ _____, approved _____ JANUARY 20, 1969 _____,

and assignment instructions dated _____ AUGUST 14 _____, 19 69.

Survey commenced _____ AUGUST 22 _____, 19 69

Survey completed _____ AUGUST 25 _____, 19 69

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

This survey, commenced August 22, 1969, was executed in accordance with the specifications as set forth in the Manual of Surveying Instructions, 1947, and the Special Instructions dated January 20, 1969.


The approximate geodetic position of corner No. 1, Lot 1, is Latitude $60^{\circ} 29.5'$ North, Longitude $149^{\circ} 47'$ West.

The bearings used in this survey were obtained from the record bearing of line 5-6, U.S. Survey No. 3531.

The magnetic declination is 25° East.

Begin at point for cor. No. 1, Lot 2B, identical with cor. No. 2, Lot 2, monumented with an iron post, $2\frac{1}{2}$ ins. diam., extending 6 ins. above ground, firmly set, mkd. and witnessed as described in the official record.

I add marks to read:

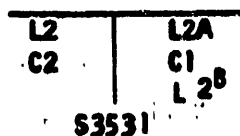

1957
69


No additional accessories taken.

N. $88^{\circ} 49'$ E., on line 1-2, Lot 2B, identical with a portion of line 1-2, U.S. Survey No. 3531.

Over gently rolling land, through spruce and aspen timber; alder and willow undergrowth.

3.60 Point for cor. No. 2, Lot 2B and cor. No. 1, Lot 2C.

Set an iron post, 26 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, with brass cap mkd.



1969

from which

A spruce, 10 ins. diam., bears S. 77° E., 9 lks. dist., mkd. S3531 L2C C1 BT.

A spruce, 6 ins. diam., bears S. 80° W., 49 lks. dist., mkd. S3531 L2B C2 BT.

Continue, on line 1-2, Lot 2C.

7.19 Cor. No. 2, Lot 2C, identical with cor. No. 1, Lot 3, monumented with a wood post, 2 x 3 ins., extending 18 ins. above ground, firmly set, and mkd. as described in the official record.

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

At the cor. point.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, and in a mound of stone, with brass cap mkd.

L2C L3
C2 C1

S3531

1969

from which

A spruce, 8 ins. diam., bears S. 5° E.,
143 lks. dist., mkd. S3531 L3 C1 BT.

A spruce, 6 ins. diam., bears S. 45° W.,
86 lks. dist., mkd. S3531 L2C C2 BT.

Reset the wood post alongside the iron post.

S. $1^{\circ} 11'$ E., on line 2-3, Lot 2C and 1-4, Lot 3.

Over gently rolling land, through spruce and aspen timber with willow undergrowth.

4.50

Cor. No. 3, Lot 2C and Cor. No. 4, Lot 3, identical with point for cor. No. 2, Lot 2D, monumented with a wood post, 2 x 3 ins., extending 18 ins. above ground, firmly set and mkd. as described in the official record.

At the cor. point.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

S3531
L2C L3
C3 C4
L2D
C2

1969

from which

A spruce, 4 ins. diam., bears N. 64° E.,
47 lks. dist., mkd. X BT.

A spruce, 8 ins. diam., bears S. 3° E.,
22 lks. dist., mkd. S3531 L2D C2 BT.

A spruce, 4 ins. diam., bears N. 36° W.,
56 lks. dist., mkd. X BT.

Reset the wood post alongside the iron post.

Continue, on line 2-3, Lot 2D.

6.00

Point for cor. No. 3, Lot 2D.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

S3531
L2D
C3

1969

from which

A spruce, 12 ins. diam., bears N. 79° W.,
94 lks. dist., mkd. S3531 L2D C3 BT.

A spruce, 10 ins. diam., bears N. 32° W.,
19 lks. dist., mkd. S3531 L2D C3 BT.

The SE. cor. of a log house, 21 x 35 ft., bears
N. 47° W., 73 lks. dist., long side extends
N. 63° W.

S. 88° 49' W., on line 3-4, Lot 2D.

Over nearly level land, through spruce and aspen timber.

3.59 Point for cor. No. 4, Lot 2D.

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins.
in the ground, with brass cap mkd.

S3531
L2D
C4

1969

from which

A spruce, 10 ins. diam., bears N. 20° E.,
31 lks. dist., mkd. S3531 L2D C4 BT.

A spruce, 8 ins. diam., bears N. 76° E.,
24 lks. dist., mkd. S3531 L2D C4 BT.

N. 1° 11' W., on line 4-1, Lot 2D.

Over nearly level land, through spruce and aspen timber.

1.50 Point for cor. No. 1, Lot 2D, cor. No. 3, Lot 2B, and cor.
No. 4, Lot 2C.

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins.
in the ground, with brass cap mkd.

S3531
L2B L2C
C3 C4
L2D
C1

1969

from which

A spruce, 10 ins. diam., bears N. 53° E.,
24 lks. dist., mkd. S3531 L2C C4 BT.

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

A spruce, 12 ins. diam., bears S. 81° E.,
43 lks. dist., mkd. S3531 L20 C1 BT.

A spruce, 8 ins. diam., bears N. 82° W.,
20 lks. dist., mkd. S3531 L28 C3 BT.

S. 88° 49' W., on line 3-4, Lot 28.

Over nearly level land through spruce and aspen timber
with willow undergrowth.

3.60

Cor. No. 3, Lot 2, identical with point for cor. No. 4,
Lot 28, an iron post, 2½ ins. diam., extending 4 ins.
above ground, firmly set, mkd. and witnessed as described
in the official record.

I add marks to read:

S3531
L2 | L2A
C3 | C4 L28

1957
69

No additional accessories taken.

N. 1° 11' W., on line 4-1, Lot 28, and 3-2, Lot 2.

Over gently rolling land, through spruce and aspen timber.

4.50

Cor. No. 1, Lot 28 and cor. No. 2, Lot 2, the point of
beginning.

MONUMENTS REPLACING WOOD POSTS

At point for cor. No. 2, Lot 1 and cor. No. 1, Lot 2,
monumented with a wood post, 2 x 3 ins., extending 18 ins.
above ground, firmly set and mkd. as described in the
official record.

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins.
in the ground, and in a mound of stone, with brass cap
mkd.

L1 | L2
C2 | C1
S3531

1969

from which

A spruce, 10 ins. diam., bears S. 36° E.,
46 lks. dist., mkd. S3531 L2 C1 BT.

A spruce, 12 ins. diam., bears S. 30° W.,
17 lks. dist., mkd. S3531 L1 C2 BT.

Reset wood post alongside the iron post.

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

At point for cor. No. 3, Lot 1 and cor. No. 4, Lot 2, monumented with a wood post, 2 x 3 ins., extending 18 ins. above ground, firmly set and mkd. as described in the official record.

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

S3531
L1 L2
C3 C4

1969

from which

A spruce, 8 ins. diam., bears N. 45° E.,
20 lks. dist., mkd. S3531 L2 C4 BT.

A spruce, 8 ins. diam., bears N. 60° W.,
45 lks. dist., mkd. S3531 L1 C3 BT.

Reset wood post alongside iron post.

At point for cor. No. 2, Lot 3A and cor. No. 1, Lot 4, monumented with a wood post, 2 x 3 ins., extending 18 ins. above ground, firmly set and mkd. as described in the official record.

Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, with brass cap mkd.

L3A L4
C2 C1
S3531

1969

from which

A spruce, 6 ins. diam., bears N. 8° E.,
34 lks. dist., mkd. XBT.

A spruce, 6 ins. diam., bears S. 70° W.,
37 lks. dist., mkd. S3531 L3A C2 BT.

Reset wood post alongside of iron post.

At point for cor. No. 3, Lot 3A and cor. No. 4, Lot 4, monumented with a wood post, 2 x 3 ins., extending 18 ins. above ground, firmly set and mkd. as described in the official record.

Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins. in the ground, and in a mound of stone, with brass cap mkd.

S3531
L3A L4
C3 C4

1969

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

from which

A spruce, 6 ins. diam., bears N. 16° E.,
27 lks. dist., mkd. S3531 L4 C4 BT.

A spruce, 4 ins. diam., bears N. 44° W.,
64 lks. dist., mkd. XBT.

Reset wood post alongside of iron post.

At point for cor. No. 2, Lot 4, and cor. No. 1, Lot 5,
monumented with a wood post, 2 x 3 ins., extending 18 ins.
above ground, firmly set and mkd. as described in the
official record.

Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins.
in the ground, and in a mound of stone, with brass cap
mkd.

L4 L5
C2 C1
S3531

1969

from which

A spruce, 4 ins. diam., bears S. 32° E.,
41 lks. dist., mkd. XBT.

A spruce, 4 ins. diam., bears S. 45° W.,
32 lks. dist., mkd. XBT.

Reset wood post alongside of iron post.

At point for cor. No. 3, Lot 4, and cor. No. 2, Lot 5,
monumented with a wood post, 2 x 3 ins., extending 18 ins.
above ground, firmly set and mkd. as described in the
official record.

Set an iron post, 28 ins. long, 2½ ins. diam., 20 ins.
in the ground, and in a mound of stone, with brass cap
mkd.

S3531
L4 L5
C3 C4

1969

from which

A spruce, 4 ins. diam., bears N. 61° E.,
39 lks. dist., mkd. XBT.

A spruce, 4 ins. diam., bears S. 76° E.,
61 lks. dist., mkd. XBT.

Reset wood post alongside of iron post.

At point for cor. No. 2, Lot 5 and cor. No. 1, Lot 5A,
monumented with a wood post, 2 x 3 ins., extending 18 ins.

-7-

DEPENDENT RESURVEY OF
U. S. SURVEY NO. 3531

CHAINS

above ground, firmly set and mkd. as described in the official record.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground, and in a mound of stone, with brass cap mkd.

L5 | L5A
C2 | C1

S3531

1969

from which

A spruce, 4 ins. diam., bears S. 60° E.,
26 lks. dist., mkd. XBT.

A spruce, 4 ins. diam., bears S. 60° W.,
42 lks. dist., mkd. XBT.

Reset wood post alongside of iron post.

At point for cor. No. 3, Lot 5 and cor. No. 4, Lot 5A, monumented with a wood post, 2×3 ins., extending 18 ins. above ground, firmly set and mkd. as described in the official record.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, with brass cap mkd.

S3531
L5 | L5A
C3 | C4

1969

from which

An aspen, 4 ins. diam., bears N. 30° E.,
17 lks. dist., mkd. XBT.

A spruce, 4 ins. diam., bears S. 66° W.,
67 lks. dist., mkd. XBT.

Reset wood post alongside of iron post.

AREA

Lot 2B	1.62 Acres
Lot 2C	1.62 "
Lot 2D	<u>0.54</u> "
TOTAL	3.78 Acres

GENERAL DESCRIPTION

This survey is located on the south side of Snug Harbor Road and west of Schakleford Creek at Kenai Lake, and is subdivided into 11 lots. The land is on a gentle north slope, covered with spruce and aspen timber, willow and alder undergrowth. The soil is mostly moss covered silt and gravel.

Form 9180-8
(March 1969)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FIELD ASSISTANTS

[illegible]

CERTIFICATE OF SURVEY

(I) ~~(We)~~, Edward T. Prendergast, HEREBY
 CERTIFY upon honor that, in pursuance of special instructions bearing date of the 20th day
 of January, 1969, (I) ~~(We)~~ have dependently resurveyed Lot 2A of
 U.S. Survey No. 3531, subdivided Lot 2A, added Lot 2D, and remonumented
 certain lot corners, situated on the southerly side of the Snug Harbor
 Road at Kenal Lake.

of the Meridian, in the State of Alaska, which
 are represented in the foregoing field notes as having been executed by (me), ~~(us)~~ and under (my)
~~(our)~~ direction; and that said survey has been made in strict conformity with said special instruc-
 tions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in
 specific manner described in the foregoing field notes.

January 12, 1970
 (Date)

Edward T. Prendergast
 (Signature)
 Edward T. Prendergast
 Cadastral Surveyor

 (Date)

 (Cadastral Surveyor)

CERTIFICATE OF APPROVAL

SUBMITTED FOR APPROVAL
 Date JAN 20 1970

BUREAU OF LAND MANAGEMENT
 Washington, D.C.

The foregoing field notes of the dependently resurveyed Lot 2A of
 U.S. Survey No. 3531, subdivision of Lot 2A, addition of Lot 2D and
 remonumentation of certain lot corners, situated on the southerly side
 of the Snug Harbor Road at Kenal Lake.

executed by Edward T. Prendergast, Cadastral Surveyor

having been critically examined and found correct, are hereby approved.

OCT 20 1970
 (Date)

Clark F. Sumner
 (Chief, Division of Cadastral Survey)

CERTIFICATE OF TRANSCRIPT

I CERTIFY That the foregoing transcript of the field notes of the above-described surveys in
 _____, is a true copy of the original field notes.

 (Date)

 (Chief, Division of Cadastral Survey) GPO-648-626